
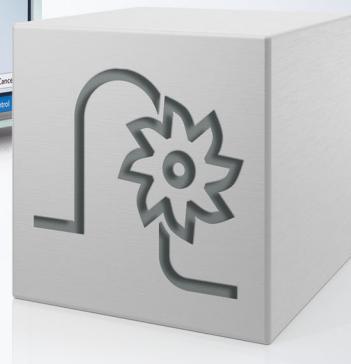


Functional description | EN

TF5200 | TwinCAT 3 CNC

Driving on fixed stop

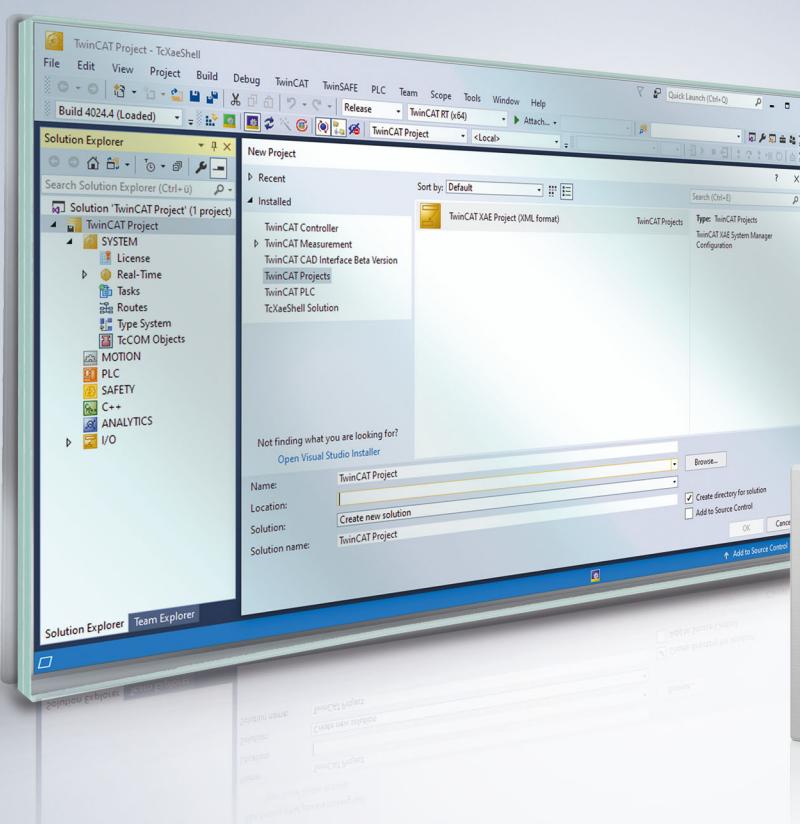

Notes on the documentation

This description is only intended for the use of trained specialists in control and automation engineering who are familiar with the applicable national standards.

It is essential that the documentation and the following notes and explanations are followed when installing and commissioning the components.

It is the duty of the technical personnel to use the documentation published at the respective time of each installation and commissioning.

The responsible staff must ensure that the application or use of the products described satisfy all the requirements for safety, including all the relevant laws, regulations, guidelines and standards.

Disclaimer

The documentation has been prepared with care. The products described are, however, constantly under development.

We reserve the right to revise and change the documentation at any time and without prior announcement. No claims for the modification of products that have already been supplied may be made on the basis of the data, diagrams and descriptions in this documentation.

Trademarks

Beckhoff®, TwinCAT®, TwinCAT/BSD®, TC/BSD®, EtherCAT®, EtherCAT G®, EtherCAT G10®, EtherCAT P®, Safety over EtherCAT®, TwinSAFE®, XFC®, XTS® and XPlanar® are registered trademarks of and licensed by Beckhoff Automation GmbH.

Other designations used in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owners.

Patent Pending

The EtherCAT technology is patent protected, in particular by the following applications and patents:
EP1590927, EP1789857, EP1456722, EP2137893, DE102015105702
with corresponding applications or registrations in various other countries.



EtherCAT® is registered trademark and patented technology, licensed by Beckhoff Automation GmbH, Germany

Copyright

© Beckhoff Automation GmbH & Co. KG, Germany.

The reproduction, distribution and utilisation of this document as well as the communication of its contents to others without express authorisation are prohibited.

Offenders will be held liable for the payment of damages. All rights reserved in the event of the grant of a patent, utility model or design.

General and safety instructions

Icons used and their meanings

This documentation uses the following icons next to the safety instruction and the associated text. Please read the (safety) instructions carefully and comply with them at all times.

Icons in explanatory text

1. Indicates an action.
- ⇒ Indicates an action statement.

DANGER

Acute danger to life!

If you fail to comply with the safety instruction next to this icon, there is immediate danger to human life and health.

CAUTION

Personal injury and damage to machines!

If you fail to comply with the safety instruction next to this icon, it may result in personal injury or damage to machines.

NOTICE

Restriction or error

This icon describes restrictions or warns of errors.



Tips and other notes

This icon indicates information to assist in general understanding or to provide additional information.

General example

Example that clarifies the text.

NC programming example

Programming example (complete NC program or program sequence) of the described function or NC command.



Specific version information

Optional or restricted function. The availability of this function depends on the configuration and the scope of the version.

Table of contents

Notes on the documentation	3
General and safety instructions	4
1 Overview	8
2 Description	9
3 Programming	11
4 Examples	17
4.1 “Move to fixed stop” with one axis	17
4.2 “Move to fixed stop” with an independent axis	17
4.3 Text for fixed stop detected	18
4.4 “Move to fixed stop” with several axes	18
5 Parameter	19
5.1 Default initialisation at controller start	20
5.1.1 Default assignment for a SERCOS drive	21
5.1.2 Default assignment for a CANopen drive	22
5.2 Overview	23
5.2.1 Start-up parameters	23
5.2.2 Axis parameters	23
5.3 Description	25
5.3.1 Start-up parameters	25
5.3.2 Axis parameters	25
6 Support and Service	34
Index	35

List of figures

Fig. 1	Deleting distance to go.....	15
Fig. 2	Circular motion converted to linear motion.....	16

1 Overview

Tasks

The “Move to fixed stop” function moves the drive to a fixed obstacle. During the move to the fixed stop a torque limit is active in the drive.

As soon as the CNC detects the fixed stop, the axis is stopped and machining continues in the next NC line.

Characteristics

“Move to fixed stop” can be used in the following applications:

- Clamping workpieces
- Simple measurement processes without measuring probe
- Applying a defined force

Parametrisation

“Move to fixed stop” is configured for each axis in the axis parameter list.

In addition the forward/backward controller must be switched on in the channel parameter list.

2 Description

The “Move to fixed stop” function can move an axis to a fixed stop and exert a defined contact pressure on the fixed stop.

The function is selected by an axis-specific command in the NC program. In addition, the axis must be moved by a path motion or a single axis motion (see [PROG//Independent axes]). Motion to the fixed stop is referred below as ‘approach block’.

After the “Move to fixed stop” function is activated:

- the CNC reduces the permitted torque in the drive and
- also switches off other monitoring functions such as the position lag monitor (see [FCT-A1]) in the CNC and in the drive.

The motion to approach the fixed stop is executed at reduced torque. The CNC then automatically reduces axis acceleration. During the approach motion the CNC monitors the position lag of the axis and increases it when the stop is reached. As soon as the specified limit is overshot:

- the CNC stops the axis,
- discards the block distance to go and
- changes to the next NC line.

As long as the axis is stationary at the fixed stop, the drive continues to apply the specified torque on the fixed stop. While the axis is moving towards the fixed stop or when it reaches the fixed stop, it may not be reprogrammed in the NC program. However, the parameters may be changed at any time, e.g. torque limit.

While the axis is stationary at the fixed stop, the CNC monitors the actual position. As soon as the actual value leaves a specified tolerance window, the CNC issues error message P-ERR-70548.

When the “Move to fixed stop” is **switched off**, the setpoint is tracked on the actual position of the axis. At the same time, the torque limit is cancelled and the monitoring functions are re-activated, e.g. position lag monitor. Together with the switch-off command, a path motion should always be specified for the axis to move away from the fixed stop.

If the fixed stop was not detected at the end of the motion block, the CNC issues error message P-ERR-50886. Output of the error message can be suppressed by the axis parameter P-AXIS-00716 or by the keyword ERR_NOT_DETECTED.

Prerequisites

“Move to fixed stop” can be used:

- For SERCOS and CANopen drives which support a maximum torque limit. Normally they are the drive objects S-0-0092 for SERCOS and 0x6072 for CANopen.
- For path or spindle axes which were replaced in the path compound.
- If the backward motion memory is not switched off in the controller, i.e. a value greater than 0 is specified for the NC channel in the start-up parameter P-STUP-00033.

Restrictions

If the "Move to fixed stop" function is active for an axis, the following commands and actions are not permitted for this axis:

- The axis may not be reprogrammed in the NC program.
Otherwise the CNC issues error message P-ERR-21967.
- The axis may not be released.
Otherwise the CNC issues error message P-ERR-21970.
- No actual position may be requested for the axis.
#CHANNEL INIT [ACTPOS].
Otherwise the CNC issues error message P-ERR-21964.
- Tracking mode may not be activated for the axis.
Otherwise the CNC issues error message P-ERR-70549.
- Drive releases may not be reset for the axis.
Otherwise the CNC issues error message P-ERR-70546.

Behaviour at CNC reset

After a reset the CNC issues error message P-ERR-70549 if:

- moving to fixed stop was interrupted by a CNC reset,
- the fixed stop is not detected and
- the parameter P-AXIS-00715 has the value 1.

The "Move to fixed stop" is then deselected.

However, if the fixed stop was already detected at CNC rest, the function "Move to fixed stop" remains active. If the parameter P-AXIS-00717 is set with the value 1, the CNC issues the warning message P-ERR-70550 during the CNC reset.

Behaviour at program end

If the function "Move to fixed stop" is not deselected before the end of the NC program, the function remains active after program end. No automatic deselection takes place.

3 Programming

Programming is based on the syntax for independent axes. When the function is activated, the required parameter settings can be defined. The settings are applied until program end. After this, the default settings in the axis parameter list are re-applied. The setting last specified in the NC program is used for non-specified parameters. If the parameter was not previously specified in the NC program, the default setting in the axis parameter list applies.

When the function is activated, motion information must always be specified for the axis. This may be a path or independent axis motion. Otherwise the controller outputs error message P-ERR-21966.

Any number of axes may participate in the motion in the approach block and be monitored at a fixed stop. It is also possible to move axes without monitoring. The approach motion stops as soon as all axes monitored at the fixed stop detect the fixed stop. The controller then discards the distance to go of the approach block and continues machining with the next NC block.

Syntax:

```
<axis_name> [ FIXED_STOP [ ON | OFF ] [ TORQUE_LIMIT=..] [POS_LAG_LIMIT=..] [CYCLES=..]
[WINDOW=..] [START=..] [END=..] [ERR_NOT_DETECTED=..] {\ \} ]
```

<axis_name>	Name of the axis to be used with the "Move to fixed stop" function.
FIXED_STOP	Identifier for position lag during "Move to fixed stop". Must always be programmed as the <u>first</u> keyword.
ON	Activate the "Move to fixed stop" function for this axis. Motion information must also be specified for the axis.
OFF	Deactivate the "Move to fixed stop" function. In addition a motion should be programmed for the axis to move away from the fixed stop.
TORQUE_LIMIT=..	Specifying the torque limit with "Move to fixed stop". Scaling is determined by parameterising the "Move to fixed stop" function from the axis parameters (see P-AXIS-00724). Normally this is given as a percentage [%] of the drive nominal torque. If no torque is specified for the axis in the NC program, the default value in the axis parameter P-AXIS-00729 is used for the torque limit.
POS_LAG_LIMIT=..	Limit for position lag in [mm, inch, °]. If this limit is overshot, the CNC reverts to the "Fixed stop reached" state after the LR cycles specified in CYCLES. If no position lag limit is specified for the axis in the NC program, the default value in the axis parameter P-AXIS-00712 is used.
CYCLES=..	Number of position controller cycles in which the position lag must be above the specified POS_LAG_LIMIT limit before the controller reverts to the "Fixed stop reached" state. If the number of position controller cycles is not specified for the axis in the NC program, the default value from the axis parameter P-AXIS-00714 [► 25] is used.
WINDOW=..	Tolerance window for fixed stop position in [mm, inch, °]. After the fixed stop is reached, the controller checks whether the actual position of the drive leaves the specified tolerance window to detect a breakaway of the fixed stop. If no tolerance window is specified for the axis in the NC program, the default value in the axis parameter P-AXIS-00713 is used. The monitor is disabled with a value of 0.
START=..	This parameter can delay the monitoring function for when the fixed stop is reached by one percent [%] referred to the path distance in order to prevent the incorrect detection of a fixed stop due to friction etc. when the axis starts off. If this parameter is not specified in the NC program, the start of the motion is always monitored (START = 0%).
END=..	This parameter can prematurely end the monitoring function for when the fixed stop is reached by one percent [%] referred to the path distance in order to prevent the incorrect detection of a fixed stop when the axis is decelerated on approaching the

target point.

If this parameter is not specified in the NC program, monitoring always takes place up to the target point of the motion block (END = 100%).

ERR_NOT_DETECTE This parameter suppresses the output of error message P-ERR-50886 if the fixed stop is not detected in the approach motion. This permits the execution of simple measurement processes, e.g. with "Move to fixed stop".
D=..
0: Output error message P-ERR-50886.
1: Do not output error message P-ERR-50886.
\ Separator ("backslash") for clear programming of the command over multiple lines.

NOTICE

A motion for the axis should always be programmed together with deactivation of the "Move to fixed stop" function. This movement **must** be away from the fixed stop. Otherwise it may result in damage to the machine if the motion continues towards the fixed stop.

V.RTA variables

State information about the “Move to fixed stop” function of an axis can be requested in the NC program. Since V.RTA variables originate from the interpolator context, an advance stop is required on access.

V.RTAs are axis-specific variables. So, when you access them, you must specify an axis instance in the form of the axis name or the axis index in the axis group of the NC channel.

Example for the Y axis on axis index 1:

```
V.RTA.FIXED_STOP.DETECTED.Y  
V.RTA.FIXED_STOP.DETECTED[1]
```

When the “Move to fixed stop” function is activated, the information in the V.RTA.FIXED_STOP variables is reset.

Variable name	Meaning	Data type	Unit	Permitted access	
				Decoder	Real-time cycle
V.RTA.FIXED_STOP.ACTIVE.X	Move to fixed stop active	Boolean	-	L	L
V.RTA.FIXED_STOP.DETECTED.X	Move to fixed stop detected	Boolean	-	L	L
V.RTA.FIXED_STOP.ACS.POS.X	Fixed stop position recorded in axis coordinate system	SGN64	[mm, inch]	L	L

Delete distance to do in the approach block with non-participating path axes

The “Move to fixed stop” function can be active simultaneously in any number of axes. In addition other axes can be moved together in the approach block even if they do not move to the fixed stop.

If all axes in the approach block detected the fixed stop, the block distance to go is discarded. If other axes participate in the motion but do not move to the fixed stop, these axes continue to move towards the target point of the next motion block starting at the abort motion.

Discard distance to go

```
N10 G01 X10 Y10 Z0 F1000  
N20 G01 X100 Z100 Z[FIXED_STOP ON TORQUE_LIMIT10]  
N30 G01 Y100
```

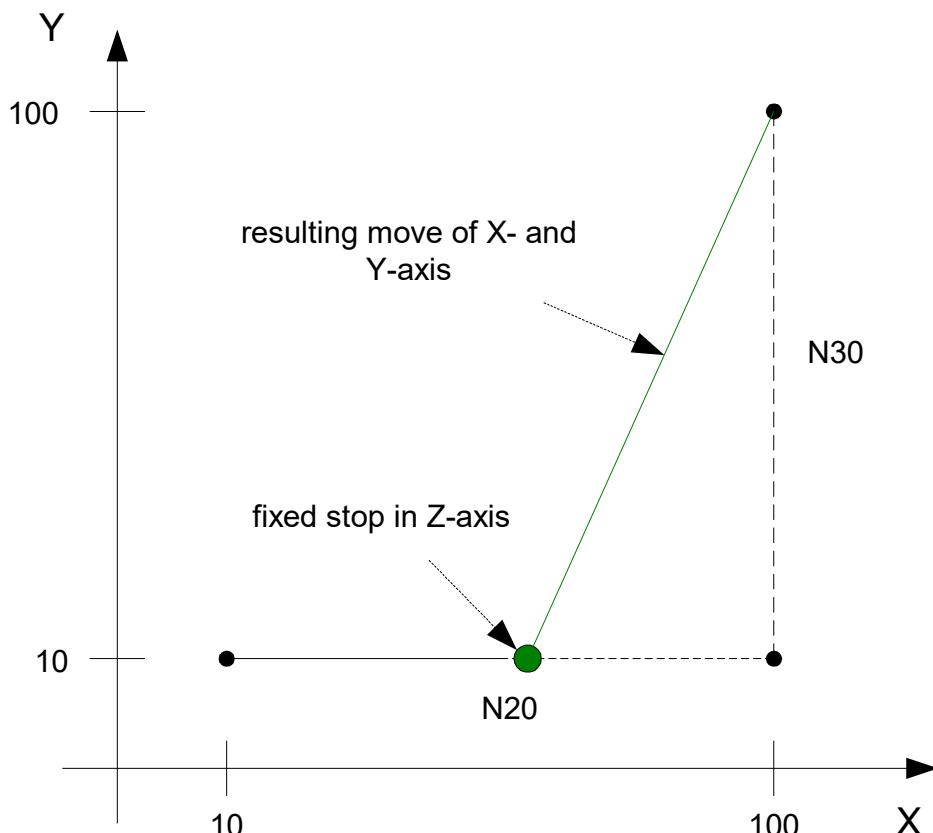


Fig. 1: Deleting distance to go

A circular motion following the approach block is converted to a linear motion; the axes approach the target point of the original circular segment directly, as shown in the example below.

Circular motion converted to linear motion

```
N10 G01 X10 Y10 Z0 F1000  
N20 G01 X100 Z100 Z[FIXED_STOP ON TORQUE_LIMIT10]  
N30 G03 Y70 J+30
```

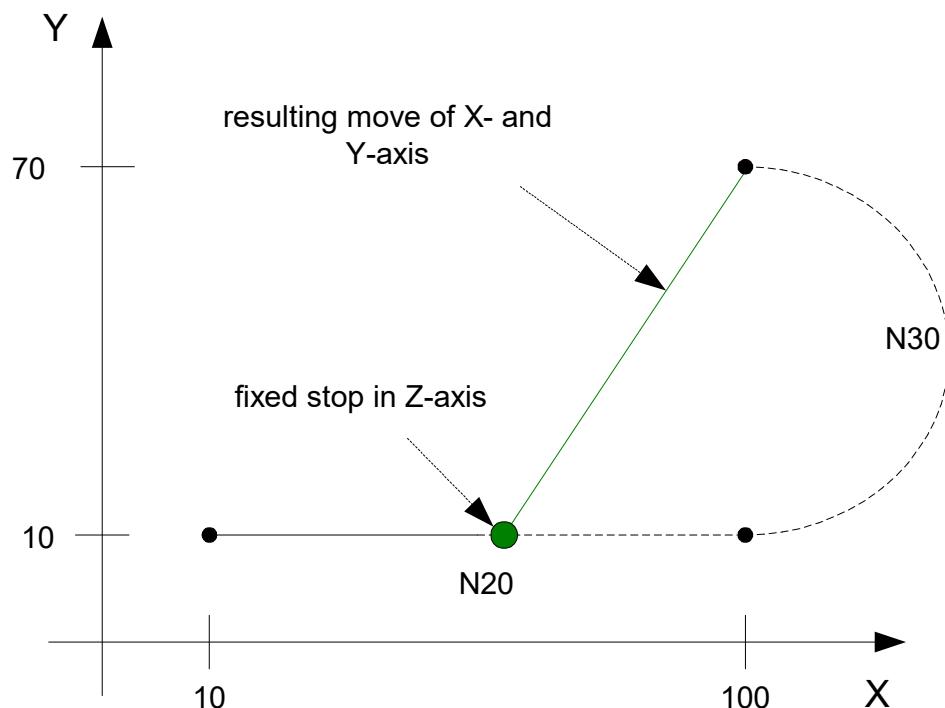


Fig. 2: Circular motion converted to linear motion

Axes which move towards the fixed stop with an independent path motion (INDP_SYN / INDP_ASYNC) have no influence on the path motion of other axes.

4 Examples

4.1 “Move to fixed stop” with one axis

In the test program below the X axis moves towards a fixed stop:

```
N010 G0 X0 Y0
```

(* Approach motion *)

```
N020 G01 X100 F10 X[FIXED_STOP ON TORQUE_LIMIT = 10]  
N030 G01 Y100 F1000
```

(* Withdrawal motion away from the fixed stop *)

```
N040 G01 X0 X[FIXED_STOP OFF]  
N050 M30
```

4.2 “Move to fixed stop” with an independent axis

In the test program below the X axis moves towards a fixed stop:

```
N010 G0 X0 Y0 F1000
```

(* Independent approach motion *)

```
N020 G01 Y100 X[INDP_ASYNC G01 POS100 FEED10] \  
X[FIXED_STOP ON TORQUE_LIMIT = 10]  
N030 G01 Y200 F1000
```

(* Withdrawal motion away from the fixed stop *)

```
N040 G01 X0 X[FIXED_STOP OFF]  
N050 M30
```

4.3 Text for fixed stop detected

In the test program below the result of the “Move to fixed stop” function is forwarded to the PLC by external variables:

```
N010 G0 X0 Y0 F1000 V.E.FS_DETECTED = FALSE
(* Parameterisation *)
X[FIXED_STOP TORQUE_LIMIT = 5 ERR_NOT_DETECTED = 0]

(* Approach motion *)
N020 G01 X100 X[FIXED_STOP ON TORQUE_LIMIT = 10]
N030 $IF V.RTA.FIXED_STOP.DETECTED.X = TRUE
N040 V.E.FS_DETECTED = TRUE
N050 V.E.FS_POSITION = V.RTA.FIXED_STOP.ACS.POS.X
N050 $ENDIF

(* Withdrawal motion away from the fixed stop *)
N040 G01 X0 X[FIXED_STOP OFF]
N050 M30
```

4.4 “Move to fixed stop” with several axes

In the test program below the X, Y and Z axes move towards a fixed stop:

```
N010 G0 X0 Y0
(* Parameterisation *)
N020 X[FIXED_STOP TORQUE_LIMIT = 10 WINDOW = 5]
N030 Y[FIXED_STOP TORQUE_LIMIT = 10 WINDOW = 10]
N040 Z[FIXED_STOP TORQUE_LIMIT = 20 WINDOW = 2]
N050 G01 X100 F1000

(* Approach motion *)
N060 X100 Z200 X2=100 F10 X[FIXED_STOP ON] Z[FIXED_STOP ON]
N070 Y100 F1000

(* Independent approach motion *)
N080 Y[INDP_ASYN G01 POS200 FEED200] Y[FIXED_STOP ON]

(* Change torque and monitoring window *)
N090 X[FIXED_STOP TORQUE_LIMIT = 15]
N100 Y[FIXED_STOP WINDOW = 5]
N110 X2 = 200

(* Independent motion of Y axis away from the fixed stop *)
N120 Y[INDP_ASYN G01 POS0 FEED1000 Y[FIXED_STOP OFF]
N130 X2 = 100 F1000

(* Move X and Z axes away from the fixed stop *)
N140 Z0 Z[FIXED_STOP OFF]
N150 X0 Z-100 X[FIXED_STOP OFF]
N160 M30
```

5 Parameter

Drive object for torque limitation

The drive torque must be reduced for the “Move to fixed stop” function. An appropriate entry must therefore be made in the drive objects. If the controller finds no object with the name 'TORQUE_LIMIT' (see P-AXIS-00719), the error message P-ERR-70541 is issued when the function is activated.

If no torque limit is programmed in the NC program, the controller uses the value in the parameter P-AXIS-00729 of the 'TORQUE_LIMIT' torque object.

Reloading parameters

While the controller is running, the following parameter settings can be changed by updating the axis parameter list or by using the #MACHINE DATA command:

- position lag limit P-AXIS-00712
- monitoring window P-AXIS-00713
- number of position lag cycles [P-AXIS-00714 \[▶ 25\]](#)
- error response if function aborted P-AXIS-00715
- error response if fixed stop not detected P-AXIS-00716
- reset warning message if fixed stop detected P-AXIS-00717
- maximum torque P-AXIS-00718

For all other parameters of the “Move to fixed stop” function, new parameter values are not accepted when the controller is running. The controller must then be restarted for these parameters.

5.1 Default initialisation at controller start

When the controller is started, a default initialisation takes places for the drive objects depending on the drive type. Entries specified in the default axis parameter list are overwritten by this default initialisation. If this is not desired, the default initialisation can be disabled for the drive object using the parameter P-AXIS-00746.



To be able to assign drive objects for the “Move to fixed stop” in the default axis parameter list, the automatic default initialisation must be disabled for the objects (see P-AXIS-00746)



If the automatic default initialisation is used, the parameters described in the sections “[Default assignment for a SERCOS drive \[▶ 22\]](#)” and “[Default assignment for a CANopen drive](#)” [▶ 22] must be checked for plausibility before the “Move to fixed stop” function, in particular the stored torque limit.

5.1.1 Default assignment for a SERCOS drive

#Disable position lag monitor

```
antr.fixed_stop.drive_ident[0].id           MON_WINDOW
antr.fixed_stop.drive_ident[0].wr_ident      S_0_0159
antr.fixed_stop.drive_ident[0].commu         ACYCLIC
antr.fixed_stop.drive_ident[0].data_type     UNS32
antr.fixed_stop.drive_ident[0].mask          NOT_USED
antr.fixed_stop.drive_ident[0].scaling_type  UNSCALED
antr.fixed_stop.drive_ident[0].scaling_factor 1.0
antr.fixed_stop.drive_ident[0].min_limit     0.0
antr.fixed_stop.drive_ident[0].max_limit     1.0e+199
antr.fixed_stop.drive_ident[0].startup_value 1048575
antr.fixed_stop.drive_ident[0].rd_ident       ""
antr.fixed_stop.drive_ident[0].active_value   0
antr.fixed_stop.drive_ident[0].use_startup_value 0
```

#Torque limit

```
antr.fixed_stop.drive_ident[1].id           TORQUE_LIMIT
antr.fixed_stop.drive_ident[1].wr_ident      S_0_0092
antr.fixed_stop.drive_ident[1].commu         ACYCLIC
antr.fixed_stop.drive_ident[1].data_type     UNS16
antr.fixed_stop.drive_ident[1].mask          NOT_USED
antr.fixed_stop.drive_ident[1].scaling_type  LINEAR
antr.fixed_stop.drive_ident[1].scaling_factor 10.0
antr.fixed_stop.drive_ident[1].min_limit     0.0
antr.fixed_stop.drive_ident[1].max_limit     100.0
antr.fixed_stop.drive_ident[1].startup_value 100.0
antr.fixed_stop.drive_ident[1].rd_ident       ""
antr.fixed_stop.drive_ident[1].active_value   1.0
antr.fixed_stop.drive_ident[1].use_startup_value 0
```

5.1.2 Default assignment for a CANopen drive

#Disable position lag monitor

```
antr.fixed_stop.drive_ident[0].id           MON_WINDOW
antr.fixed_stop.drive_ident[0].wr_ident      6065_00
antr.fixed_stop.drive_ident[0].commu         ACYCLIC
antr.fixed_stop.drive_ident[0].data_type     UNS32
antr.fixed_stop.drive_ident[0].mask          NOT_USED
antr.fixed_stop.drive_ident[0].scaling_type   UNSCALED
antr.fixed_stop.drive_ident[0].scaling_factor 1.0
antr.fixed_stop.drive_ident[0].min_limit     0.0
antr.fixed_stop.drive_ident[0].max_limit     1.0e+199
antr.fixed_stop.drive_ident[0].startup_value 1048575
antr.fixed_stop.drive_ident[0].rd_ident       ""
antr.fixed_stop.drive_ident[0].active_value   4294967295
antr.fixed_stop.drive_ident[0].use_startup_value 0
```

#Torque limit

```
antr.fixed_stop.drive_ident[1].id           TORQUE_LIMIT
antr.fixed_stop.drive_ident[1].wr_ident      6072_00
antr.fixed_stop.drive_ident[1].commu         ACYCLIC
antr.fixed_stop.drive_ident[1].data_type     UNS16
antr.fixed_stop.drive_ident[1].mask          NOT_USED
antr.fixed_stop.drive_ident[1].scaling_type   LINEAR
antr.fixed_stop.drive_ident[1].scaling_factor 10.0
antr.fixed_stop.drive_ident[1].min_limit     0.0
antr.fixed_stop.drive_ident[1].max_limit     500.0
antr.fixed_stop.drive_ident[1].startup_value 500.0
antr.fixed_stop.drive_ident[1].rd_ident       ""
antr.fixed_stop.drive_ident[1].active_value   1.0
antr.fixed_stop.drive_ident[1].use_startup_value 0
```

5.2 Overview

5.2.1 Start-up parameters

ID	Parameter	Description
P-STUP-00033	fb_storage_size[i]	Memory size for backward motion

5.2.2 Axis parameters

ID	Parameter	Description
P-AXIS-00712	antr.fixed_stop.pos_lag_limit	Position lag limit to detect the fixed stop
P-AXIS-00713	antr.fixed_stop.window	Monitoring window for the fixed stop
P-AXIS-00714	Antr.fixed_stop.nbr_cycles	Number of position controller cycles to detect the fixed stop
P-AXIS-00715	Antr.fixed_stop.error_on_abort	Error output on abort by reset
P-AXIS-00716	Antr.fixed_stop.error_not_detected	Error output if fixed stop is not detected
P-AXIS-00717	antr.fixed_stop.warning_reset_while_detected	Warning message on reset and detected fixed stop
P-AXIS-00718	antr.fixed_stop.max_torque	Motor torque at maximum axis acceleration
P-AXIS-00719	antr.fixed_stop.drive_ident[i].id	CNC-internal identifier for the drive object
P-AXIS-00720	antr.fixed_stop.drive_ident[i].commu	Type of communication with drive controller
P-AXIS-00721	antr.fixed_stop.drive_ident[i].wr_ident	Name of the drive object in the driver amplifier
P-AXIS-00722	antr.fixed_stop.drive_ident[i].data_type	Data type of the data to be transmitted
P-AXIS-00723	antr.fixed_stop.drive_ident[i].startup_value	Default value of data element after controller start-up
P-AXIS-00724	antr.fixed_stop.drive_ident[i].scaling_type	Scaling type of the data element
P-AXIS-00725	antr.fixed_stop.drive_ident[i].max_limit	Maximum permissible output value
P-AXIS-00726	antr.fixed_stop.drive_ident[i].min_limit	Minimum permissible output value
P-AXIS-00727	antr.fixed_stop.drive_ident[i].mask	Write/read by bit mask
P-AXIS-00728	antr.fixed_stop.drive_ident[i].scaling_factor	Scaling factor
P-AXIS-00729	antr.fixed_stop.drive_ident[i].active_value	Value of data element during "Move to fixed stop"
P-AXIS-00730	antr.fixed_stop.drive_ident[i].use_startup_value	Use of default value
P-AXIS-00731	antr.fixed_stop.drive_ident[i].rd_ident	Name of the drive object to be read in the driver amplifier
P-AXIS-00746	antr.fixed_stop.drive_ident[i].default	Use of default parameters for the drive type

ID	Parameter	Description
P-AXIS-00762	antr.fixed_stop.quick_s_top_after_detection	Quick stop after detecting the fixed stop
P-AXIS-00763	antr.fixed_stop.error_missing_drive_releases	Error reaction for missing drive releases.

5.3 Description

5.3.1 Start-up parameters

P-STUP-00033	Memory size for backward motion
Description	This parameter defines the memory size in bytes used for backward motion on the path. During start-up, the NC checks whether the required minimum size is available. If this is not the case, a warning is output and the memory size is set to the required minimum value. If the size is set to 0, the “forward/ backward motion on the path” function is not available. The maximum size is only limited by the resources available on the PC.
Parameter	fb_storage_size[i] where i = 0 to 11 (maximum number of channels: 12, application-specific)
Data type	UNS32
Data range	0 ... MAX(UNS32)
Dimension	----
Default value	0
Remarks	

5.3.2 Axis parameters

P-AXIS-00712	Position lag limit to detect the fixed stop	
Description	This parameter defines this limit for the position lag for the “Move to fixed stop” function after which an overshoot of the fixed stop is detected. Finally, the CNC stops the axis and discards the distance to go of the NC block.	
Parameter	antr.fixed_stop.pos_lag_limit	
Data type	UNS32	
Data range	$0 \leq \text{pos_lag_limit} \leq \text{MAX(UNS32)}$	
Axis types	T, R	
Dimension	T: $0.1\mu\text{m}$	R: 0.0001°
Default value	20000	
drive types.	SERCOS, CANopen	
Remarks	The measurement (G100, measurement type 7) with motion to a stop is also subject to the limit in the parameter P-AXIS-00331	

P-AXIS-00713	Monitoring window for the fixed stop.
Description	This parameter defines a tolerance window for the fixed stop. If the actual position of the axis leaves the tolerance window after the fixed stop is detected, the CNC issues the error message P-ERR-70548. If this parameter is changed after the fixed stop is detected, the CNC assumes the current fixed stop position as the centre of the new tolerance window.
Parameter	antr.fixed_stop.window
Data type	UNS32
Data range	$0 \leq \text{pos_lag_limit} \leq \text{MAX(UNS32)}$
Axis types	T, R
Dimension	T: $0.1\mu\text{m}$ R: 0.0001°
Default value	0
drive types.	SERCOS, CANopen
Remarks	The monitor is disabled with the value 0.

P-AXIS-00714 Number of position controller cycles to detect the fixed stop

Description	This parameter defines the number of position controller cycles which the position lag of the axis must overshoot the specified position lag limit P-AXIS-00712 before the fixed stop is detected. Counting starts from the beginning if the limit is again undershot during this time.	
Parameter	antr.fixed_stop.nbr_cycles	
Data type	UNS16	
Data range	0 < nbr_cycles < MAX(UNS32)	
Axis types	T, R	
Dimension	T: Number of interpolation cycles	R: Number of interpolation cycles
Default value	10	
drive types.	SECOS, CANopen	
Remarks	The measurement (G100, measurement type 7) with motion to a stop is also subject to the limit in the parameter P-AXIS-00332	

P-AXIS-00715 Error output on abort by reset		
Description	This parameter defines whether the error message P-ERR-70549 is output if a CNC reset occurs while moving to the fixed stop.	
Parameter	antr.fixed_stop.error_on_abort	
Data type	BOOLEAN	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: -	R: -
Default value	1	
drive types.	SERCOS, CANopen	
Remarks		

P-AXIS-00716 Error message if fixed stop is not detected		
Description	This parameter defines whether the error message P-ERR-50886 is output while moving to the fixed stop if the fixed stop was not detected in the approach block.	
Parameter	antr.fixed_stop.error_not_detected	
Data type	BOOLEAN	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: -	R: -
Default value	1	
drive types.	SERCOS, CANopen	
Remarks		

P-AXIS-00717 Warning message on reset and detected fixed stop		
Description	This parameter defines whether the warning message P-ERR-70550 is output at a CNC reset if the axis is stationary at the fixed stop.	
Parameter	antr.fixed_stop.warning_reset_while_detected	
Data type	BOOLEAN	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: -	R: -
Default value	1	
drive types.	SERCOS, CANopen	
Remarks		

P-AXIS-00718 Motor torque at maximum axis acceleration	
---	--

Description	This parameter defines the motor torque which the drive requires to accelerate at maximum axis acceleration P-AXIS-00008. This parameter uses the controller to compensate axis acceleration to the reduced drive torque when moving to fixed stop.	
Parameter	antr.fixed_stop.max_torque	
Data type	REAL64	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: Scaling dependent on P-AXIS-00724	R: Scaling dependent on P-AXIS-00724
Default value	P-AXIS-00726 maximum torque limit if P-AXIS-00726 is specified; otherwise 0.0 (acceleration reduction disabled)	
Drive types	SERCOS, CANopen	
Remarks	The value 0.0 disables acceleration reduction when moving to the fixed stop.	

Up to 4 drive objects can be configured for moving to the fixed stop and can be changed when the function is activated or deactivated in the drive:

Structure name	Permitted range
drive_ident[i]	$0 \leq i \leq 3$ (Number of drive functions: 4, application-specific)

P-AXIS-00719	CNC-internal identifier for the drive object
Description	This parameter specifies a name for the drive object. The keyword TORQUE_LIMIT is reserved for the torque limit. When moving to the fixed stop, the controller checks whether a drive object is configured with the name TORQUE_LIMIT. Otherwise, the controller issues the error message P-ERR-70541.
Parameter	antr.fixed_stop.drive_ident[i].id
Data type	STRING
Data range	Maximum of 29 characters
Axis types	T, R
Dimension	T: ---- R: ----
Default value	*
Drive types	SERCOS, CANopen
Remarks	<p>Example:</p> <p>Defining the torque limit for a SERCOS drive:</p> <pre>antr.fixed_stop.drive_ident[0].id T antr.fixed_stop.drive_ident[0].wr_ident</pre> <p style="text-align: right;">TORQUE_LIMIT</p> <p>* Note: The default value of variables is a blank string.</p>

P-AXIS-00720	Type of communication with drive controller
Description	This parameter defines the type of communication by which the function in the drive is addressed. The value can be transferred both in the cyclic process data and in the service channel with SERCOS or SDO communication with CANopen.
Parameter	antr.fixed_stop.drive_ident[i].commu
Data type	STRING
Data range	<p>CYCLIC: The drive object is switched by a telegram element that is configured in the cyclic drive telegram. The name of the telegram element must then be parameterised in the P-AXIS-00721 parameter. The telegram element must be configured in the cyclic process data.</p> <p>ACYCLIC: The drive function is activated by writing a drive parameter via the parameter channel. The name of the telegram element must then be parameterised in the P-AXIS-00721 parameter.</p> <p>IGNORE: No value is exchanged with the drive.</p>

Axis types	T, R	
Dimension	T: ----	R: ----
Default value	ACYCLIC	
drive types.	SERCOS, CANopen	
Remarks		

P-AXIS-00721	Name of the drive object in the driver amplifier	
Description	This parameter defines which drive parameter or which telegram element is to be changed with <u>Moving to fixed stop</u> [► 9].	
Parameter	antr.fixed_stop.drive_ident[i].wr_ident	
Data type	STRING	
Data range	Maximum of 29 characters	
Axis types	T, R	
Dimension	T: ----	R: ----
Default value	*	
Drive types	SERCOS, CANopen	
Remarks	Example: Defining the torque limit for a SERCOS drive: antr.fixed_stop.drive_ident[0].id TORQUE_LIMIT antr.fixed_stop.drive_ident[0].wr_ident S_0_0092 * Note: The default value of variables is a blank string.	

P-AXIS-00722	Data type of the data to be transmitted	
Description	This parameter defines the data type of the drive parameter or telegram element.	
Parameter	antr.fixed_stop.drive_ident[i].data_type	
Data type	STRING	
Data range	SGN16: Signed 16 bit integer SGN32: Signed 32 bit integer UNS16: Unsigned 16-bit integer UNS32: Unsigned 32-bit integer BITARRAY_16: Bit array 16 bit BITARRAY_32: Bit array 32 bit	
Axis types	T, R	
Dimension	T: ----	R: ----
Default value	SGN16	
Drive types	SERCOS, CANopen	
Remarks		

P-AXIS-00723	Default value of data element after controller start-up	
Description	When cyclic communication is used (see P-AXIS-00720), this parameter defines the value of the telegram element after controller start-up. This parameter is also used if reading the current value at the start of motion to fixed stop is not required (see P-AXIS-00730). At the end of the move to fixed stop function, the controller writes this value back to the drive.	
Parameter	antr.fixed_stop.drive_ident[i].startup_value	
Data type	REAL64	
Data range	Dependent on the data type P-AXIS-00722 of the drive object SGN16: MIN(SGN16) ≤ startup_value ≤ MAX(SGN16) SGN32: MIN(SGN32) ≤ startup_value ≤ MAX(SGN32)	

	UNS16: MIN(UNS16) ≤ startup_value ≤ MAX(UNS16) SGN32: MIN(SGN32) ≤ startup_value ≤ MAX(SGN32)
Axis types	T, R
Dimension	T: ---- R: ----
Default value	0
drive types.	SERCOS, CANopen
Remarks	This parameter must be assigned if the data item is transferred cyclically, i.e. the parameter P-AXIS-00720 has the value CYCLIC or reading the active parameter value is suppressed, i.e. P-AXIS-00730 has the value 1.

P-AXIS-00724	Scaling type of the data element									
Description	<p>This parameter scales the transferred value before it is transferred to the drive or after the value was read by the drive. This parameter sets the unit of the data item in the NC program independently of the drive.</p> <p>The scaling type influences the values of the following parameters:</p> <ul style="list-style-type: none"> • Torque at maximum acceleration P-AXIS-00718 • Default value = P-AXIS-00723 • Maximum permissible value P-AXIS-00725 • Minimum permissible value P-AXIS-00726 • Drive value while moving to fixed stop P-AXIS-00729 									
Parameter	antr.fixed_stop.drive_ident[i].scaling_type									
Data type	STRING									
Data range	UNSCALED.	The value is not scaled, i.e. the value in the NC program directly corresponds to the value in the drive								
	LINEAR.	The value is weighted by a linear scaling factor (see P-AXIS-00728)								
	TORQUE_DRIVE_SIDE.	<p>The programmed value is a torque value related to the motor shaft and is scaled to the drive torque format with the parameters P-AXIS-00325, P-AXIS-00326 and P-AXIS-00392.</p> <p>The scaling factor does not change during gear change.</p> <p>The conversion factor is:</p> $f = \frac{1}{P - \text{AXIS} - 00392} * \frac{P - \text{AXIS} - 00325}{P - \text{AXIS} - 00326}$								
Axis types	T, R									
Dimension	T: ----	R: ----								
Default value	UNSCALED									
drive types.	SERCOS, CANopen									
Remarks	<p>Example:</p> <p>The torque limit in the SERCOS drive is specified in per mil of the maximum motor torque. However, the torque should be specified in percent in the NC program:</p> <table style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">antr.fixed_stop.drive_ident[0].id</td> <td style="width: 50%;">TORQUE_LIMIT</td> </tr> <tr> <td>antr.fixed_stop.drive_ident[0].wr_ident</td> <td>S_0_0092</td> </tr> <tr> <td>antr.fixed_stop.drive_ident[0].scaling_type</td> <td>LINEAR</td> </tr> <tr> <td>antr.fixed_stop.drive_ident[0].scaling_factor</td> <td>10</td> </tr> </table>		antr.fixed_stop.drive_ident[0].id	TORQUE_LIMIT	antr.fixed_stop.drive_ident[0].wr_ident	S_0_0092	antr.fixed_stop.drive_ident[0].scaling_type	LINEAR	antr.fixed_stop.drive_ident[0].scaling_factor	10
antr.fixed_stop.drive_ident[0].id	TORQUE_LIMIT									
antr.fixed_stop.drive_ident[0].wr_ident	S_0_0092									
antr.fixed_stop.drive_ident[0].scaling_type	LINEAR									
antr.fixed_stop.drive_ident[0].scaling_factor	10									

P-AXIS-00725	Maximum permissible output value
--------------	----------------------------------

Description	This parameter defines the maximum permissible output value. If the value specified in the configuration lists or in the NC program overshoots the set limit, it is automatically limited to the maximum value. No error message is then output. If P-AXIS-00725 is configured, P-AXIS-00726 must be less than this parameter, otherwise the warning P-ERR-70385 is output and the values are swapped. No value limit takes place by default. Irrespective of this parameter setting, a value range check always takes place with the specified data type P-AXIS-00722. If an overflow is detected, the controller outputs the error message P-ERR-70384.
Parameter	antr.fixed_stop.drive_ident[i].max_limit
Data type	REAL64
Data range	Dependent on P-AXIS-00722 and P-AXIS-00724
Axis types	T, R
Dimension	T: ---- R: ----
Default value	1.000000e+199
Drive types	SERCOS, CANopen
Remarks	By default no limit is active; the limit is disabled at a value of 1.000000e+199.

P-AXIS-00726	Minimum permissible output value
Description	This parameter defines the minimum permissible output value. If the value specified in the configuration lists or in the NC program undershoots the set limit, it is automatically limited to the minimum value. No error message is then output. If P-AXIS-00726 is configured, the parameter value must be greater than P-AXIS-00725, otherwise the warning P-ERR-70385 is output and the values are swapped. No value limit takes place by default. Irrespective of this parameter setting, a value range check always takes place with the specified data type P-AXIS-00722. If an overflow is detected, the controller outputs the error message P-ERR-70384.
Parameter	antr.fixed_stop.drive_ident[i].min_limit
Data type	REAL64
Data range	Dependent on P-AXIS-00722 and P-AXIS-00724
Axis types	T, R
Dimension	T: ---- R: ----
Default value	1.000000e+199
Drive types	SERCOS, CANopen
Remarks	By default no limit is active; the limit is disabled at a value of 1.000000e+199.

P-AXIS-00727	Writing/reading drive values by bit mask
Description	This parameter defines the bit mask to be used to read and write drive values bitwise. If the writing value (default value P-AXIS-00726 or the value when motion to the fixed stop is active P-AXIS-00729) is greater than zero, the bit mask is set; when the value is zero, the bits in the bit mask are deleted from the value transferred to the drive. When read, the value of a bit is returned if all the bits in the bit mask are set in the read drive object. Otherwise the return value is 0. This parameter is only used if the data type configured in P-AXIS-00722 has either the value 'BITARRAY_16' or 'BITARRAY_32'. The value of the bit mask must fit in the data type of the drive object P-AXIS-00722, otherwise the controller issues the error message P-ERR-70403.
Parameter	antr.fixed_stop.drive_ident[i].mask
Data type	STRING
Data range	Dependent on P-AXIS-00722: BITARRAY_16: Bit mask 16 Bit - 0 ... MAX(UNS16)

	BITARRAY_32: Bit mask 32 Bit - 0 ... MAX(UNS32)	
Axis types	T, R	
Dimension	T: ----	R: ----
Default value	NOT_USED	
Drive types	SERCOS, CANopen	
Remarks		

P-AXIS-00728	Scaling factor	
Description	This parameter executes a scaling for reading and writing the drive object. This parameter only acts if the scaling type P-AXIS-00724 is set to 'LINEAR'.	
Parameter	antr.fixed_stop.drive_ident[i].scaling_factor	
Data type	REAL64	
Data range	Unequal to 0	
Axis types	T, R	
Dimension	T: -	R: -
Default value	1.0	
drive types.	SERCOS, CANopen	
Remarks	Example: The torque limit in the SERCOS drive is specified in per mil of the maximum motor torque. However, the torque should be specified in percent in the NC program: <pre>antr.fixed_stop.drive_ident[0].id TORQUE_LIMIT antr.fixed_stop.drive_ident[0].wr_ident S_0_0092 antr.fixed_stop.drive_ident[0].scaling_type LINEAR antr.fixed_stop.drive_ident[0].scaling_factor 10</pre>	

P-AXIS-00729	Value of data element during Move to fixed stop	
Description	This parameter specifies the value which the drive object must assume while moving to fixed stop. The specified value may also be scaled before output to the drive (see P-AXIS-00728).	
Parameter	antr.fixed_stop.drive_ident[i].active_value	
Data type	REAL64	
Data range	Unequal to 0	
Axis types	T, R	
Dimension	T: - , dependent on P-AXIS-00728	R: - , dependent on P-AXIS-00728
Default value	0.0	
drive types.	SERCOS, CANopen	
Remarks	Example: When moving to fixed stop, the torque should be limited to 10% of maximum torque: <pre>antr.fixed_stop.drive_ident[0].id TORQUE_LIMIT antr.fixed_stop.drive_ident[0].wr_ident S_0_0092 antr.fixed_stop.drive_ident[0].scaling_type LINEAR antr.fixed_stop.drive_ident[0].scaling_factor 10 antr.fixed_stop.drive_ident[0].active_value 10</pre>	

P-AXIS-00730	Use of default value
Description	Normally, when moving to fixed stop is activated, the value of the drive object is read out before the object is changed by activating the function. After the function ends, the original settings are restored. If this parameter is set to 1, the start value P-AXIS-00723 is transferred to the drive instead of at the end of motion to fixed stop. The read process on activation can then be omitted.
Parameter	antr.fixed_stop.drive_ident[i].use_startup_value

Data type	BOOLEAN	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: -	R: -
Default value	0	
drive types.	SERCOS, CANopen	
Remarks	If the object is communicated in the cyclic process data (P-AXIS-00720 = 'CYCLIC'), it is advisable to set this parameter to the value 1 since the start value in P-AXIS-00723 is already transferred cyclically to the drive.	

P-AXIS-00731	Name of the drive object to be read in the driver amplifier	
Description	If the name of the drive object is different for read and write access, the name of the drive object to be read can also be specified here. If no value is specified here, the controller uses the name of the object in P-AXIS-00721 for read and write.	
Parameter	antr.fixed_stop.drive_ident[i].rd_ident	
Data type	STRING	
Data range	Maximum of 29 characters	
Axis types	T, R	
Dimension	T: -	R: -
Default value	*	
Drive types	SERCOS, CANopen	
Remarks	* Note: The default value of variables is a blank string.	

P-AXIS-00746	Use default parameters for the drive type	
Description	By default the drive objects for moving to fixed stop are preconfigured for each drive type when the controller starts and this overwrites any assignment made in the default axis parameter list. All parameters required to change the drive objects are affected by pre-initialisation, i.e. the parameters assigned in the structure antr.fixed_stop.drive_ident[i].*. However, if a parameterisation is used from the default list, this parameter can be set to the value 0. In this case, no default initialisation of the drive object takes place.	
Parameter	antr.fixed_stop.drive_ident[i].default	
Data type	BOOLEAN	
Data range	0 / 1	
Axis types	T, R	
Dimension	T: -	R: -
Default value	1	
Drive types	SERCOS, CANopen	
Remarks		

P-AXIS-00762	Quick stop after detecting the fixed stop.
Description	This parameter is used to force an immediate stop when the fixed stop is detected. Normally, after the fixed stop is detected, the axes are stopped at the feedhold acceleration P-AXIS-00024 set for this axis. For time reasons, an immediate stop can be forced by the axis parameter "quick_stop_after_detection". The condition for this is that all axes involved in the approach movement detected a stop as, in this case, all moving axes are already at a standstill due to the stop. If other axes are also involved in the approach movement, the CNC therefore stops the axes at their normal deceleration rates P-AXIS-00024 despite the fact that the "quick_stop_after_detection" parameter is set.
Parameter	antr.fixed_stop.quick_stop_after_detection
Data type	BOOLEAN

Data range	0 / 1	
Axis types	T, R	
Dimension	T: ----	R: ----
Default value	0	
Drive types	SERCOS, CANopen	
Remarks		

P-AXIS-00763 Error reaction for missing drive releases.		
Description	If the drive releases are reset after the fixed stop is detected, the CNC generates the error message P-ERR-70546 and aborts the function "Move to fixed stop". This behaviour can be changed by the parameter "error_missing_drive_releases". In any case, missing releases result in the abortion of the function "Move to fixed stop".	
Parameter	antr.fixed_stop.error_missing_drive_releases	
Data type	STRING	
Data range	ERROR: Output of error message P-ERR-70546 and the Move to fixed stop function is aborted WARNING: Output of warning P-ERR-70546 and the Move to fixed stop function is aborted NONE: Abort the Move to fixed stop function	
Axis types	T, R	
Dimension	T: ----	R: ----
Default value	ERROR	
Drive types	SERCOS, CANopen	
Remarks	Check the motion range of the axis before you set each release again. The stop obstacle must be removed.	

6 Support and Service

Beckhoff and their partners around the world offer comprehensive support and service, making available fast and competent assistance with all questions related to Beckhoff products and system solutions.

Download finder

Our download finder contains all the files that we offer you for downloading. You will find application reports, technical documentation, technical drawings, configuration files and much more.

The downloads are available in various formats.

Beckhoff's branch offices and representatives

Please contact your Beckhoff branch office or representative for local support and service on Beckhoff products!

The addresses of Beckhoff's branch offices and representatives round the world can be found on our internet page: www.beckhoff.com

You will also find further documentation for Beckhoff components there.

Beckhoff Support

Support offers you comprehensive technical assistance, helping you not only with the application of individual Beckhoff products, but also with other, wide-ranging services:

- support
- design, programming and commissioning of complex automation systems
- and extensive training program for Beckhoff system components

Hotline: +49 5246 963-157
e-mail: support@beckhoff.com

Beckhoff Service

The Beckhoff Service Center supports you in all matters of after-sales service:

- on-site service
- repair service
- spare parts service
- hotline service

Hotline: +49 5246 963-460
e-mail: service@beckhoff.com

Beckhoff Headquarters

Beckhoff Automation GmbH & Co. KG

Huelshorstweg 20
33415 Verl
Germany

Phone: +49 5246 963-0
e-mail: info@beckhoff.com
web: www.beckhoff.com

Index

P

P-AXIS-00712	25
P-AXIS-00713	25
P-AXIS-00714	25
P-AXIS-00715	26
P-AXIS-00716	26
P-AXIS-00717	26
P-AXIS-00718	26
P-AXIS-00719	27
P-AXIS-00720	27
P-AXIS-00721	28
P-AXIS-00722	28
P-AXIS-00723	28
P-AXIS-00724	29
P-AXIS-00725	29
P-AXIS-00726	30
P-AXIS-00727	30
P-AXIS-00728	31
P-AXIS-00729	31
P-AXIS-00730	31
P-AXIS-00731	32
P-AXIS-00746	32
P-AXIS-00762	32
P-AXIS-00763	33
P-STUP-00033	25

More Information:
www.beckhoff.com/TF5200

Beckhoff Automation GmbH & Co. KG
Hülsorstweg 20
33415 Verl
Germany
Phone: +49 5246 9630
info@beckhoff.com
www.beckhoff.com

